


F-12G-SDI-TX/RX

Quick Setup Guide

Step 1: Connect Power



1). Connect the included DC12V Power Supplies to the TRANSMITTER (TX) and the RECEIVER (RX)

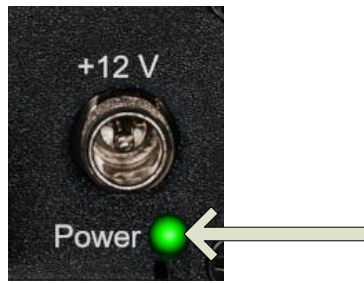


2). Power indicator LEDs on both the TX and RX will light GREEN when the units are receiving power.

Step 2: Connect Fiber

1). Connect the FIBER ports of the TX and RX using single mode fiber with LC connectors. (up to 20km distance)



LC UPC

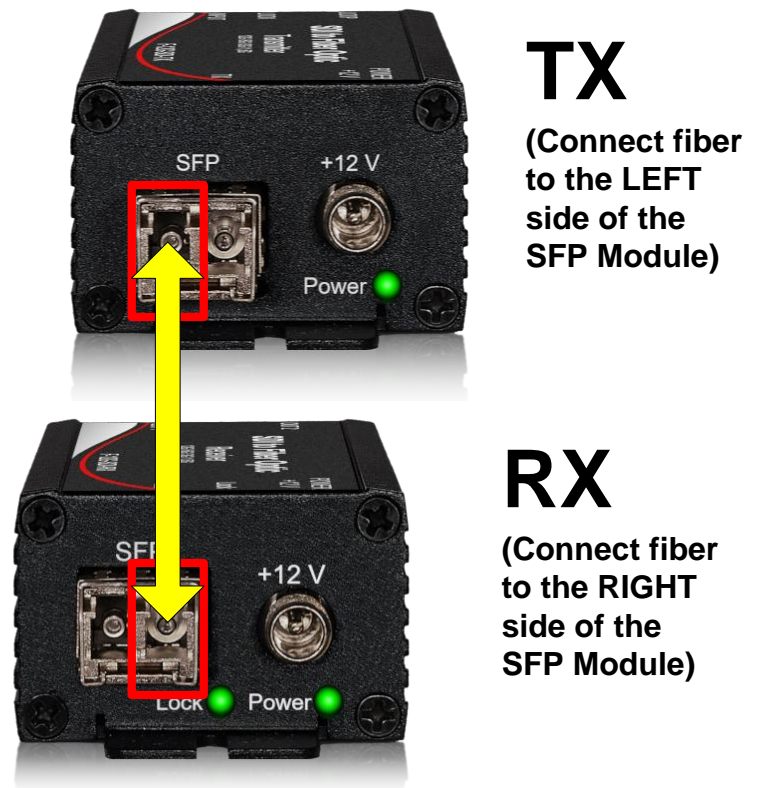


TX
(Connect fiber to the LEFT side of the SFP Module)

RX
(Connect fiber to the RIGHT side of the SFP Module)

Step 3: Connections

- 1). Connect SDI source to TX Input
- 2). Connect Local Monitor to TX Loop
- 3). Connect Remote Monitors to RX Out 1 and RX Out 2

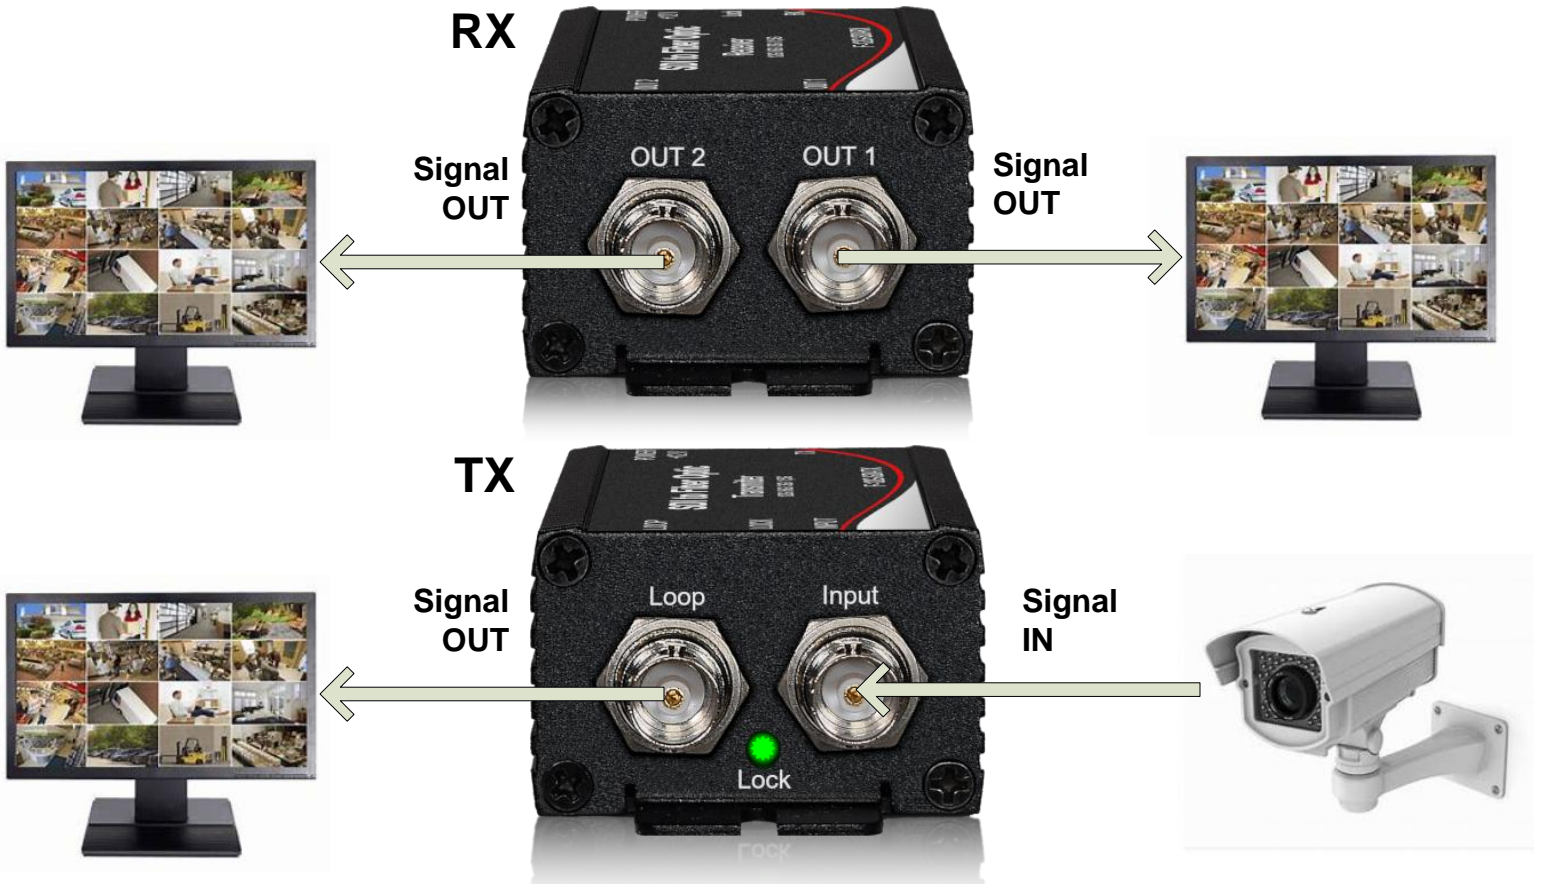

- 4). The "Lock" LEDs on both units will light GREEN when a valid SDI signal is detected on the TX INPUT.



Scan for more info:



F-12G-SDI-TX/RX

Quick Setup Guide



<https://thorbroadcast.com>

800-521-8467

sales@thorfiber.com